

To Order Fittings: Specify model number followed by the size code and option code.
Examples: MF81T-P-150 or TF81T-S-200-17

1/2"	3/4"	1"	1 1/2"	2"	3"	4"	6"	8"
-050	-075	-100	-150	-200	-300	-400	-600	-800

Tee Fittings for IP81 Paddlewheel Sensors: 1/2" to 4"

Model No.	Material / Style	-050	-075	-100	-150	-200	-300	-400
MF81T-P	PVC / Schedule 80 male pipe stub	√	√	√	√	√	Note 1	Note 1
MF81TC-B	Bronze / female sweat (for copper tube)	√	√	√	√	√	√	√
MF81T-B	Bronze NPTF	√	√	√	√	√	√	√
MF81T-S	304SS NPTF	√	√	√	√	√		
MF81T-C	Carbon Steel NPTF	√	√	√	√	√		

Note 1: Use MF82S-P with Option - 16

Tee Fittings for TX81 Turbine Sensors: 1" to 4"

Model No.	Material / Style	-100	-150	-200	-300	-400
TF81T-P	PVC / Schedule 80 male pipe stub	√	√	√	Note 1	Note 1
TF81TC-B	Bronze / female sweat (for copper tube)	√	√	√	√	√
TF81T-B	Bronze NPTF	√	√	√	√	√
TF81T-S	304SS NPTF	√	√	√		
TF81T-C	Carbon Steel NPTF	√	√	√		

Note 1: Use MF82S-P with Option - 16


Option	Description
-14	All 316 SS (MT81T-S or TF81T-S only)
-17	304 SS ANSI 150 # flanges (MF81T-S or TF81T-S only)

Saddle Fittings for IP to TX 80 Series: 3" to 8"

Model No.	Material	-300	-400	-600	-800
MF82S-P	PVC (Note 2)	√	√	√	√
MF82S-F	Ductile Iron	√	√	√	√
MF82S-Y	Polypropylene	√	√	√	√
MF82S-B	Bronze	√	√		

Note 2: PVC saddles are supplied with Buna-N O-rings only. For chemical service the O-ring must be removed and the saddle must be glued onto the pipe with PVC cement used as directed.

Option	Description
-16	Installed on 16" long pipe stub (PVC Schedule 80 only)

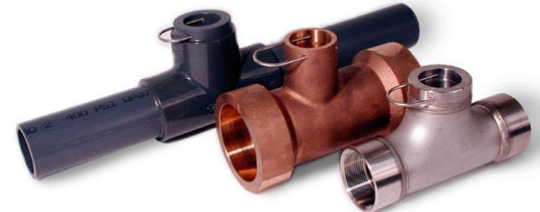

Tee Fittings



Weld Fittings



Saddle Fittings

Weld / Braze Fittings for IP or TX 80 Series: 3" to 8"

Model No.	Material	-300	-400	-600	-800
MF82W-B	Bronze	√	√	√	√
MF82W-C	Carbon Steel	√	√	√	√
MF82W-S	316 SS	√	√	√	√